

# Imray Correction Notice

20 July 2011

## Chart D10 WGS 84

*Edition May 2003*

*Date of printing May 2003*

The following corrections should be noted:

### 1 Golfo de Paria

Diamond Rock and Middle Channel port and stbd Lt buoys are reported missing (2003) (ILNW 436/03)

### 2 Caution

Poisonous snakes are to be found on Peninsula de Paria and killer bees on Chacachacare I. (ILNW 24/04)

### 3 Golfo de Paria, Islas Patos

Amend range of Lt at I Patos to 10M in 10°38'·0N 61°52'·0W (ILNW 371/04)

### 4 Golfo de Paria, Isla Cotorra northwards

Insert dangerous Wk sym in 10°14'·0N 62°18'·0W and marker buoy close north (ILNW 402/04)

### 5 Brighton (Chart & Plan L)

Delete Ldg Lts and Igd, Ldg Lts 139·25°. Insert Igd 'Oil Platform Construction Yard' centred on 10°14'·75N 61°37'·75W. The buoys are no longer lit. (ILNW 37/05)

### 6 Golfo de Paria, Punta del Arenal

Insert stranded Wk sym in 10°03'·0N 61°56'·1W (ILNW 232/05)

### 7 Pointe a Pierre (Plan K)

Longitude Scale. Substitute 28'·5 for 29' on north longitude scale (ILNW 573/05)

### 8 Point Lisas Industrial Port

Amend Ldg Lts:

Front from Fl.R.4s to Fl.1s30m8M in 10°24'·2N 61°29'·6W

Rear Fl.R.4s to Fl.2s41m8M in 10°24'·5N 61°29'·3W (ILNW 575/05)

### 9 Golfo de Paria

Delete Lanby SPM in 10°20'·5N 61°31'·6W and Y can 'E' in 100°10'·2N 61°59'·W (ILNW 585/05)

### 10 Chaguaramus Bay (Plan J) (*correction amended - see ILNW 458/06*)

Insert dangerous Wk sym in 10°40'·46N 61°38'·31W (ILNW 305/06)

### 11 Peninsula de Paria, N coast

Insert Lt Fl.12s43m12M(PA) in 10°42'·4N 62°08'·3W (ILNW 417/06)

### 12 Chaguaramus Bay (Plan J)

Insert isolated danger Lt buoy Fl(2)10s at dangerous Wk in 10°40'·46N 61°38'·31W (ILNW 458/06)

### 13 Golfo de Paria

Insert:

Platform sym in 10°05'·2N 62°15'·4W

Storage Unit in 10°14'·7N 62°08'·9W

and pipeline connecting the two (Due for completion (12/07)). (ILNW 25/07)

### 14 Golfo de Paria, Point Fortin northwestwards

Delete Y can Lt buoy 'A' Fl.Y.5s in 10°18'·4N 61°45'·0W (ILNW 34/10)

### 15 General Notice

Before visiting this area, mariners are advised to check [www.safetyandsecuritynet.com](http://www.safetyandsecuritynet.com).

The Venezuelan HO changes light characteristics on a regular basis, making it difficult to keep corrections up to date. Lights are seldom moved, but characteristics are regularly changed. (ILNW 138/10)

**16 Peninsula de Paria, Punta Peñas**

Insert Lt Fl.15s75m11M in 10°44'·12N 61°50'·96W (ILNW 236/11)